

Monitoring Details:

Crack and Level Monitoring

Provider Name: CET

Monitoring Interval: Every 8 weeks

Instruction Date: 22/11/2022

Number of Visits: 8

Reading Date: 18/07/2024

Visits Completed: 8

Date of Issue: 18/07/2024

Visits Outstanding: 0

Client Details:

Client: Sedgwick

Engineer / Handler: 


Job Reference: 

Monitored Address:


Address: 50 Dragon Parade, Harrogate, North Yorkshire, HG1 5DQ

Front Elevation



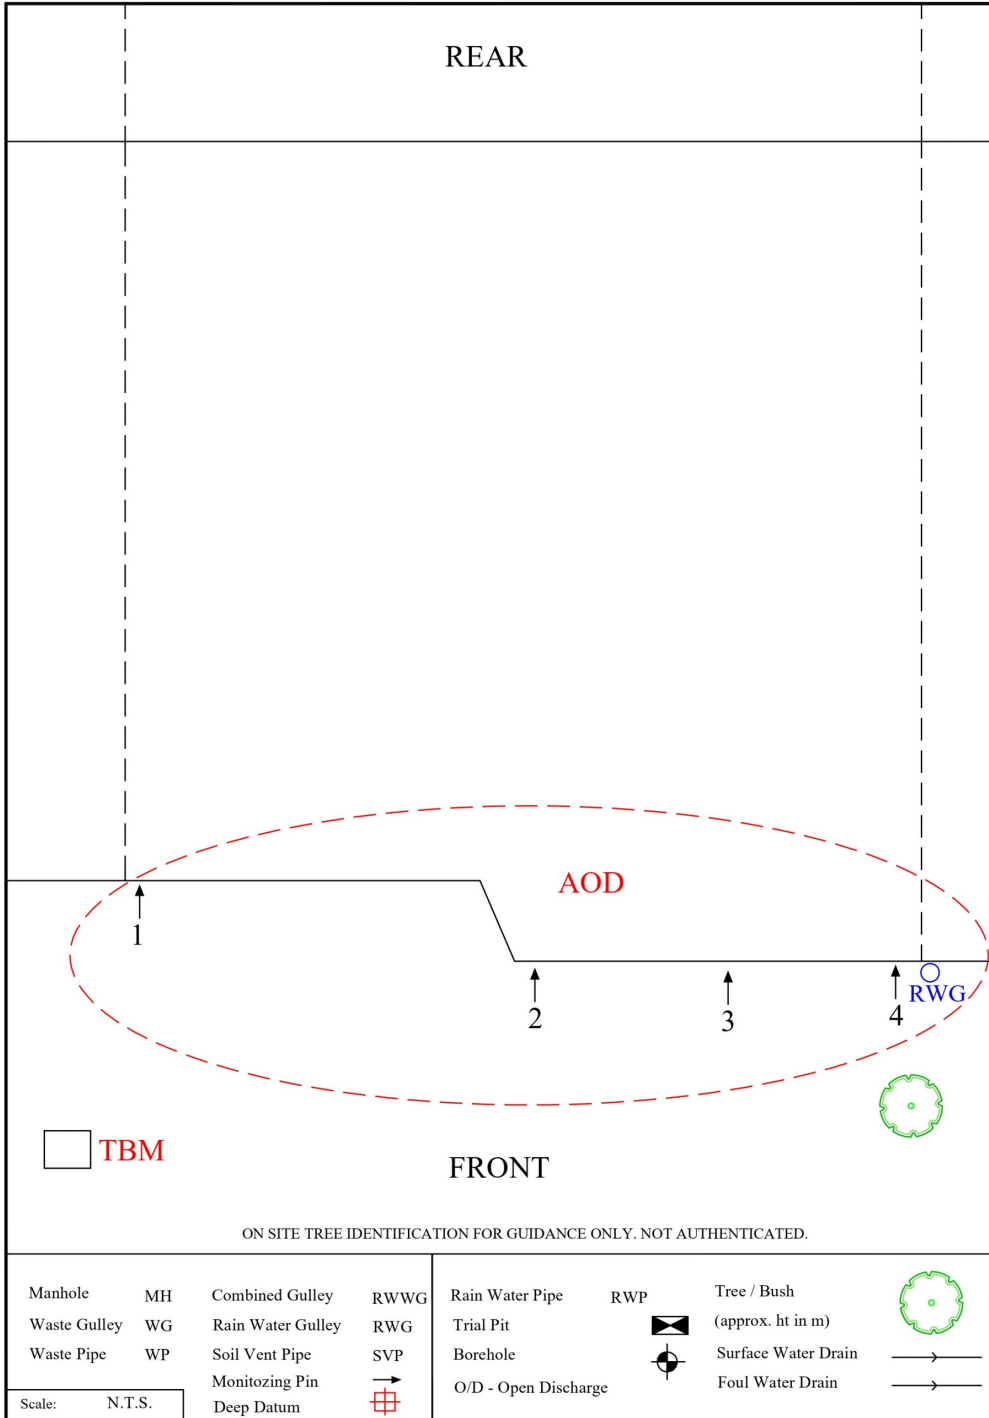

Level Readings Chart (Points 1 - 4)

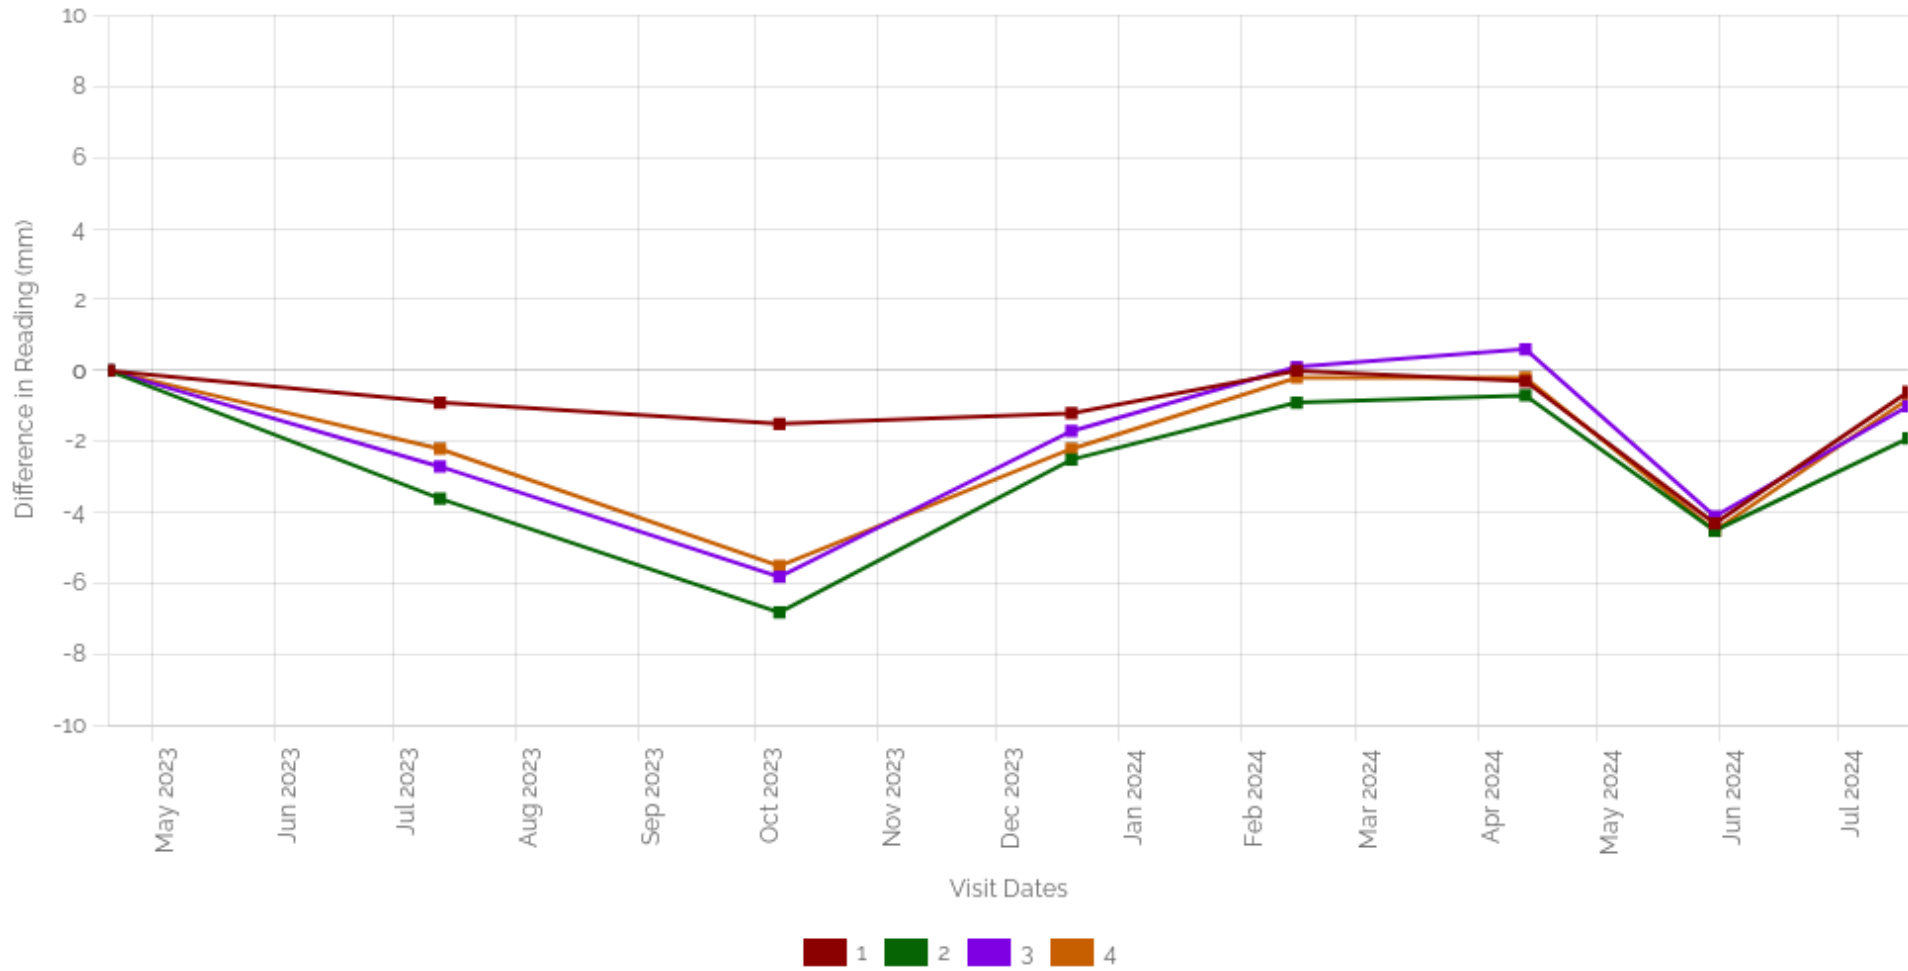


Crack Monitoring

Internal right hand side party wall

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	19/04/23	12/07/23	06/10/23	19/12/23	14/02/24	12/04/24	30/05/24	18/07/24
H	7533	7588	7716	7595	7592	7602	7604	7605
V	9218	9271	9404	9272	9274	9271	9271	928
C	5777	5764	578	5783	5777	5779	578	5781
Taken by	DC	DC	DC	DC	JH	DC	DC	DC
Callipers	8568	8568	8568	8568	2016	5236	5236	5236

Internal right hand side party wall - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	19/04/23	12/07/23	06/10/23	19/12/23	14/02/24	12/04/24	30/05/24	18/07/24
H	0	0.55	1.82	0.62	0.59	0.69	0.71	0.72
V	0	0.53	1.85	0.54	0.56	0.53	0.53	0.62
C	0	-0.13	0.03	0.06	0	0.02	0.03	0.04

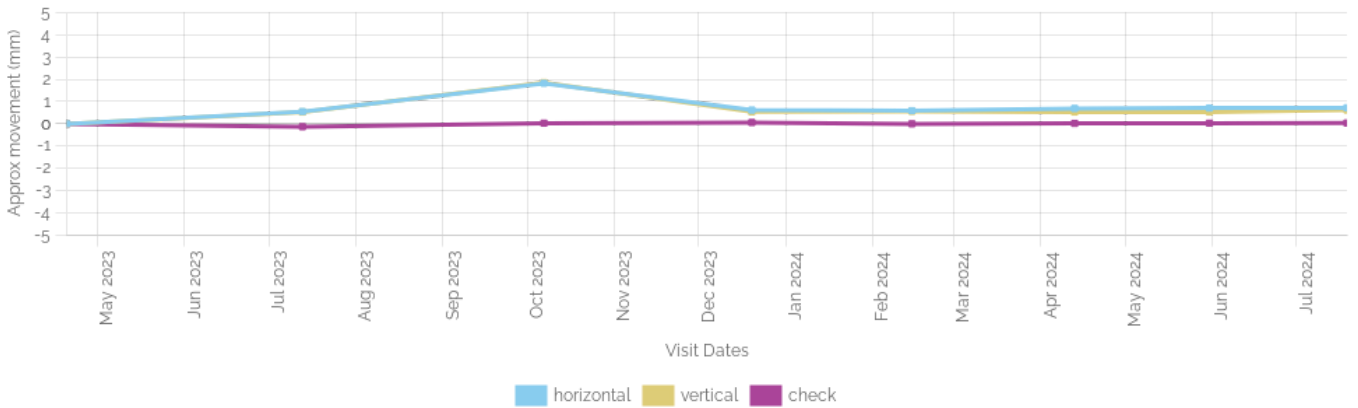

Internal right hand side party wall - Visit #1



Internal right hand side party wall - Visit #8




Crack Monitoring

Internal front bedroom right hand side party wall

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	19/04/23	12/07/23	06/10/23	19/12/23	14/02/24	12/04/24	30/05/24	18/07/24
H	62.28	62.3	62.24	62.21	62.29	62.29	62.12	61.06
Taken by	DC	DC	DC	DC	JH	DC	DC	DC
Callipers	8568	8568	8568	8568	2016	5236	5236	5236

Internal front bedroom right hand side party wall - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	19/04/23	12/07/23	06/10/23	19/12/23	14/02/24	12/04/24	30/05/24	18/07/24
H	0	0.01	-0.04	-0.07	0	0.01	-0.16	-1.23

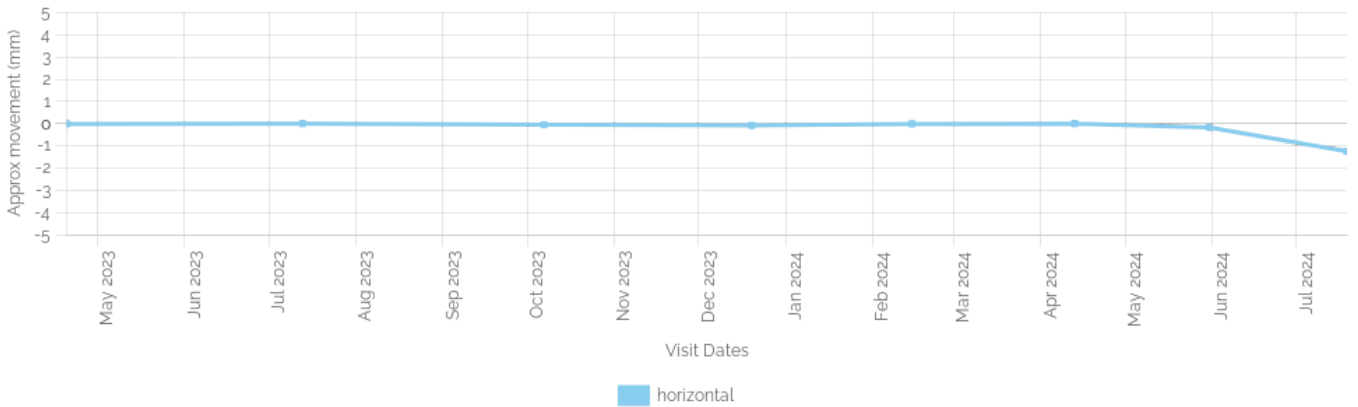

Internal front bedroom right hand side party wall - Visit #1



Internal front bedroom right hand side party wall - Visit #8




Crack Monitoring

Internal front bedroom external wall left of window

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	19/04/23	12/07/23	06/10/23	19/12/23	14/02/24	12/04/24	30/05/24	18/07/24
H	48.76	48.82	48.77	47.78	48.88	48.74	48.77	48.75
Taken by	DC	DC	DC	DC	JH	DC	DC	DC
Callipers	8568	8568	8568	8568	2016	5236	5236	5236

Internal front bedroom external wall left of window - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	19/04/23	12/07/23	06/10/23	19/12/23	14/02/24	12/04/24	30/05/24	18/07/24
H	0	0.06	0.02	-0.97	0.12	-0.01	0.02	-0

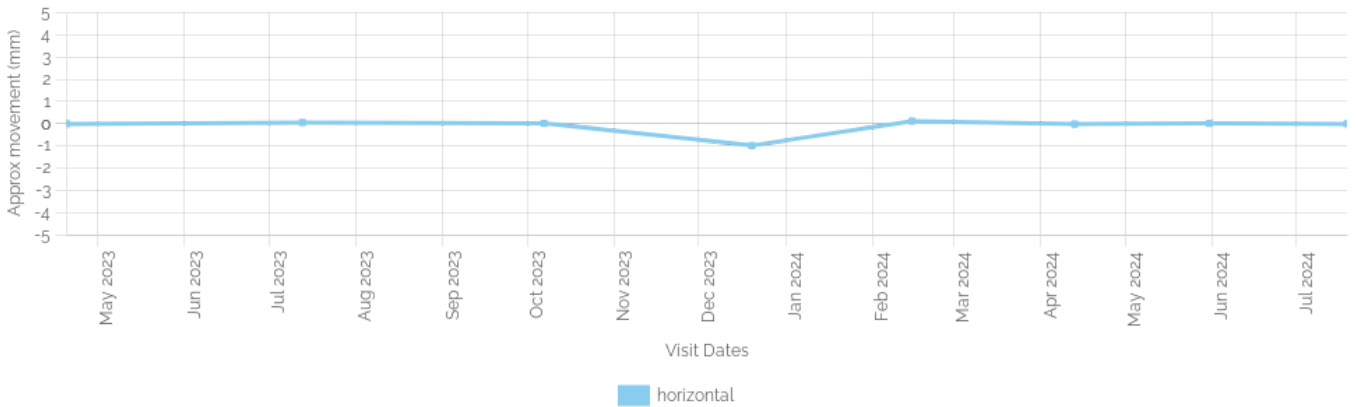

Internal front bedroom external wall left of window - Visit #1



Internal front bedroom external wall left of window - Visit #8

